


# King Meter KM529 LCD User Guide

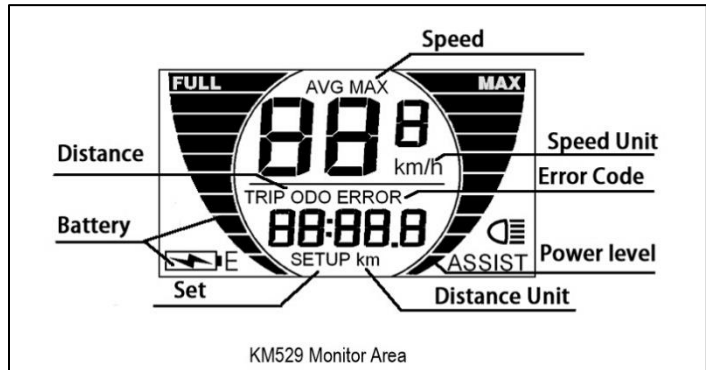

## Function summary

The KM529 provides a wide range of functions and indicators to fit all users' needs. The indicated contents are as follows:

- Battery Indicator
- Speed Display (including real-time speed, average speed and max speed).
- Trip distance and total distance.
- PAS Level Selection.
- Headlight On/Off.
- Error Code Indicator.
- Various Parameters Setting, such as wheel size, speed-limiter & back-light brightness.

## Display Controls

The KM529 offers 3 soft-touch controls, which activate a selection of features programmed within the KM529. Listed below is an outline of these functions:

- Power display ON: Hold power/mode button for 3 sec.
- Headlight ON/OFF: Hold (+) button for 3 sec.
- Walk assist: Hold (-) button for 3 sec. (will remain active until button is released).
- Change speed display (current, avg., max): Press power/mode & (+) buttons simultaneously.
- Reset trip meter: Press power & (-) buttons simultaneously for 3 sec.
- Enter display setup: Hold (+) & (-) buttons simultaneously for 3 sec. Adjust settings via +/- controls. Save settings via power/mode button. Exit setup by holding power/mode button for 3 sec.

